













## Recall Summary – European Toys

### EU Safety Gate Alerts (Feb 2025)




Alert No.	Notifying Country	Product	Product Photo	Hazard / Risk	Measures Adopted
OR/00026/25	UK	<b>Soft toy</b>  (Country of Origin: <b>China</b> )		<b>Choking</b> The fibrous stuffing material of the toy is easily accessible due to the weakness of certain seams. A small child may put them in their mouth and choke. The product does not comply with the requirements of the Toy Safety Directive nor with the relevant European standard EN 71-1.	Destruction of the product
OR/00031/25	Malta	<b>Climbing frame with slide</b>  (Country of Origin: <b>Israel</b> )		<b>Entrapment, Injuries</b> Children's fingers can become trapped in an accessible gap near the starting section of the slide. Moreover, the climbing frame can tip over due to insufficient stability, causing children to fall and be injured by the fall or by the frame falling on them. The product does not comply with the requirements of the General Product Safety Directive nor with the European standards EN 71-1 and EN 71-8.	Withdrawal of the product from the market
OR/00032/25	France	<b>Soft toy</b>  (Country of Origin: <b>China</b> )		<b>Choking</b> The fibrous stuffing material of the toy is easily accessible due to the weakness of certain seams. A small child may put it in their mouth and choke. The product does not comply with the requirements of the Toy Safety Directive nor with the European standard EN 71-1.	Recall of the product from end users
OR/00034/25	France	<b>Soft toy</b>  (Country of Origin: <b>China</b> )		<b>Choking</b> The fibrous stuffing material of the toy is easily accessible due to the weakness of certain seams. A small child may put it in their mouth and choke. The product does not comply with the requirements of the Toy Safety Directive nor with the relevant European standard EN 71-1.	Removal of this product listing by the online marketplace

OR/00035/25	Hungary	<b>Soft toy</b>  (Country of Origin: <b>China</b> )		<b>Choking</b> The fibrous stuffing material of the toy is easily accessible due to the weakness of certain seams. A small child may put the filling material in their mouth and choke. The product does not comply with the requirements of the Toy Safety Directive nor with the relevant European standard EN 71-1.	Import rejected at border
OR/00036/25	Finland	<b>Toy swing</b>  (Country of Origin: <b>Finland</b> )		<b>Strangulation</b> Due to the incomplete instructions provided, the swing can be installed too high, leaving openings where the child can have its head entangled, leading to strangulation. The toy does not comply with the requirements of the Toy Safety directive nor with the European standards EN 71-8.	Making the marketing of the product subject to prior conditions
OR/00037/25	Hungary	<b>Toy scooter</b>  (Country of Origin: <b>Türkiye</b> )		<b>Injuries</b> The handlebar locking mechanism of the scooter may release under load and the steering column may slip down. This could cause the child to lose balance and fall off, leading to injuries. The product does not comply with the requirements of the Toy Safety Directive nor with the European standard EN 71-1.	Recall of the product from end users
SR/00485/25	Romania	<b>Kitchen toy set</b>  (Country of Origin: <b>China</b> )		<b>Choking, Damage to sight</b> Due to its characteristic appearance, form, colour and size, the product may be mistaken for foodstuff. The product contains small parts. A small child may put them in their mouth and choke. The product does not comply with the requirements of the Food Imitating Directive and the Toy Safety Directive, nor with the European standard EN 71-1.	Ban on the marketing of the product and any accompanying measures

SR/00486/25	UK	<b>Baby stroller</b>  (Country of Origin: <b>China</b> )		<b>Choking, Injuries</b> The stroller's restraint system does not have a crotch restraint. The child is therefore not properly secured, and can fall and be injured. The product also has a label that can easily detach, producing a small part. A small child may put it in their mouth and choke. The product does not comply with the requirements of the General Product Safety Directive.	Import rejected at border
SR/00490/25	Sweden	<b>Electric monkey doll</b>  (Country of Origin: <b>China</b> )		<b>Environment</b> The solders in the product have an excessive concentration of lead (measured value up to 58% by weight). Lead poses a risk to the environment. The product does not comply with the requirements of the Directive on the restriction of the use of certain hazardous substances in electrical and electronic equipment (RoHS 2 Directive).	Import rejected at border
SR/00491/25	Sweden	<b>Toy bubble gun</b>  (Country of Origin: <b>China</b> )		<b>Environment</b> The solders in the product have an excessive concentration of lead (measured value up to 74% by weight). Lead poses a risk to the environment. The product does not comply with the requirements of the Directive on the restriction of the use of certain hazardous substances in electrical and electronic equipment (RoHS 2 Directive).	Import rejected at border
SR/00492/25	UK	<b>Baby stroller</b>  (Country of Origin: <b>China</b> )		<b>Choking, Injuries</b> The stroller's restraint system does not have a crotch restraint. As a result, the child would not be properly secured, and can fall and be injured. Moreover, the product has a label which can easily detach, producing a small part. A small child can put the label in their mouth and choke. The product also has moving parts which can cause injuries to the child. The product does not comply with the requirements of the General Product Safety Directive.	Import rejected at border

SR/00493/25	Sweden	<b>Toy bubble machine</b>  (Country of Origin: <b>China</b> )		<b>Environment</b> The solders in the product have an excessive concentration of lead (measured value up to 74% by weight). Lead poses a risk to the environment. The product does not comply with the requirements of the Directive on the restriction of the use of certain hazardous substances in electrical and electronic equipment (RoHS 2 Directive).	Import rejected at border
SR/00494/25	Sweden	<b>Toy spacecraft</b>  (Country of Origin: <b>China</b> )		<b>Environment</b> The solders in the product have an excessive concentration of lead (measured value up to 44% by weight). Lead poses a risk to the environment. The product does not comply with the requirements of the Directive on the restriction of the use of certain hazardous substances in electrical and electronic equipment (RoHS 2 Directive).	Import rejected at border
SR/00496/25	UK	<b>Baby stroller</b>  (Country of Origin: <b>China</b> )		<b>Choking, Injuries</b> The stroller's restraint system does not have a crotch restraint. The child is therefore not properly secured, and can fall and suffer injuries. The product also has a label which can easily detach. A small child can put it in their mouth and choke. Moreover, the product has moving parts which can cause injuries to the child. The product does not comply with the requirements of the General Product Safety Directive.	Destruction of the product
SR/00497/25	France	<b>Toy slingshot</b>  (Country of Origin: <b>Unknown</b> )		<b>Injuries</b> The kinetic energy of the projectiles is too high (measured value up to 4350 mJ/m <sup>2</sup> ) and exceeds the permitted levels. This could cause injury, in particular to the eyes. The product does not comply with the requirements of the Toy Safety Directive nor with the European standard EN 71-1.	Withdrawal of the product from the market


SR/00499/25	UK	<b>Baby pushchair</b>  (Country of Origin: <b>China</b> )		<b>Choking, Injuries</b> The product has a small part (label on the restraint strap) which can easily detach. A young child may put it in their mouth and choke. Moreover, the product's restraint system does not have the crotch restraint integrated. As a result, the child would not be properly secured if both restraints were not in use, causing them to slip and injure themselves. Additionally, the product has sharp edges, which cause cuts or injuries to a child. The product does not comply with the requirements of the General Product Safety Directive.	Import rejected at border
SR/00503/25	Poland	<b>Soft toy</b>  (Country of Origin: <b>China</b> )		<b>Choking</b> The toy has small parts (eyes) which can be easily detached. Small children may put them in their mouth and choke. The product does not comply with the requirements of the Toy Safety Directive nor with the European standard EN 71-1.	Warning consumers of the risks
SR/00518/25	Lithuania	<b>Soother holder</b>  (Country of Origin: <b>Denmark</b> )		<b>Choking</b> The beads of the soother holder do not have the required ventilation holes. Small children can put them in their mouth and choke. The product does not comply with the General Product Safety Regulation.	Withdrawal of the product from the market
SR/00532/25	France	<b>Wooden toy</b>  (Country of Origin: <b>China</b> )		<b>Choking</b> The toy has small parts (ball on lid) which can easily detach. A child may put it into their mouth and choke. The product does not comply with the requirements of the Toy Safety Directive nor with the European standard EN 71-1.	Recall of the product from end users
SR/00533/25	Slovenia	<b>Wooden puzzle</b>  (Country of Origin: <b>Unknown</b> )		<b>Choking</b> The toy has small parts (ear of the white rabbit) which may easily detach. A child may put it into their mouth and choke. The product does not comply with the requirements of the Toy Safety Directive nor with the European standard EN 71-1.	Recall of the product from end users
SR/00538/25	Spain	<b>Plastic toy</b>  (Country of Origin: <b>China</b> )		<b>Choking</b> The toy has protruding parts. A small child may put them in their mouth and choke. The product does not comply with the requirements of the Toy Safety Directive nor with the European standards EN 71-1 and EN 62115.	Withdrawal of the product from the market






SR/00542/25	Poland	<b>Electric airplane toy</b>  (Country of Origin: <b>China</b> )		<b>Environment</b>  The metal components of the product have an excessive concentration of lead and cadmium (measured values up to 84.6% and 1.04% by weight respectively). Lead poses a risk to the environment. Cadmium bio-accumulates and poses a risk to the environment. The product does not comply with the requirements of the Directive on the restriction of the use of certain hazardous substances in electrical and electronic equipment (RoHS 2 Directive).	Warning consumers of the risks
SR/00558/25	Sweden	<b>Toy gun</b>  (Country of Origin: <b>China</b> )		<b>Environment</b>  The product has excessive concentrations of cadmium (measured value up to 1.34% by weight). Cadmium bio-accumulates and poses a risk to the environment. The product does not comply with the requirements of the Directive on the restriction of the use of certain hazardous substances in electrical and electronic equipment (RoHS 2 Directive).	Withdrawal of the product from the market
SR/00566/25	Sweden	<b>Trampoline</b>  (Country of Origin: <b>Spain</b> )		<b>Injuries</b>  The padding covering the trampoline's springs can move from its initial position, leaving the springs and the holes between each spring exposed. The user can fall between two springs, resulting in sprains, stretches, fractures or concussion. Moreover, the trampoline is unstable and can easily tip if the user falls against the safety net. Additionally, the safety net is too low, which can lead a user jumping over it and falling off of the trampoline, creating a risk of injury. The product does not comply with the requirements of the General Product Safety Directive nor with the European standard EN 71-14.	Recall of the product from end users




SR/00573/25	Sweden	<b>Key ring with toy</b>  (Country of Origin: <b>China</b> )		<b>Chemical, Environment</b> The solders in the product have an excessive concentration of cadmium (measured value up to 0.61% by weight). Cadmium bio-accumulates and poses a risk to the environment. The product does not comply with the requirements of the Directive on the restriction of the use of certain hazardous substances in electrical and electronic equipment (RoHS 2 Directive).	Withdrawal of the product from the market
SR/00578/25	France	<b>Wooden toy set</b>  (Country of Origin: <b>China</b> )		<b>Choking</b> The toy pieces are not firmly bonded, which means that they can be easily detached causing small parts. A child may put it into their mouth and choke. The product does not comply with the requirements of the Toy Safety Directive nor with the European standard EN 71-1.	Withdrawal of the product from the market
SR/00579/25	Poland	<b>Plastic toy</b>  (Country of Origin: <b>China</b> )		<b>Chemical</b> The toy contains an excessive amount of diisobutyl phthalate (DIBP) (measured value up to 6.42% by weight). This phthalate may harm the health of children, possibly by causing damage to the reproductive system. The product does not comply with the REACH Regulation.	Warning consumers of the risks
SR/00580/25	Poland	<b>Plastic ball</b>  (Country of Origin: <b>China</b> )		<b>Chemical</b> The toy contains an excessive amount of dibutyl phthalate (DBP) and diisobutyl phthalate (DIBP) (measured values up to 1.71% and 20.6% by weight, respectively). These phthalates may harm the health of children, possibly by causing damage to the reproductive system. The product does not comply with the REACH Regulation.	Warning consumers of the risks

SR/00582/25	Poland	<b>Plastic ball</b>  (Country of Origin: <b>China</b> )		<b>Chemical</b> The plastic material of the toy contains an excessive amount of dibutyl phthalate (DBP) and diisobutyl phthalate (DIBP) (measured values up to 3.75% and 3.35% by weight, respectively). These phthalates may harm the health of children by causing possible damage to the reproductive system. The product does not comply with the REACH Regulation.	Destruction of the product
SR/00594/25	Croatia	<b>Soother</b>  (Country of Origin: <b>Türkiye</b> )		<b>Choking</b> The product has small parts (teat) which may easily detach. A child may put it in their mouth and choke. The product does not comply with the General Product Safety Regulation nor with the European standard EN 1400.	Recall of the product from end users
SR/00598/25	Lithuania	<b>Soother holder</b>  (Country of Origin: <b>Germany</b> )		<b>Choking, Suffocation</b> The soother holder does not have the required ventilation holes, leading to suffocation. The clasp of the soother holder is protruding. A small child can put it in their mouth and choke. The product does not comply with the requirements of the General Product Safety Directive nor with the European standard EN71-1.	Withdrawal of the product from the market
SR/00604/25	Estonia	<b>Plastic doll</b>  (Country of Origin: <b>China</b> )		<b>Chemical</b> The toy has an excessive concentration of bis(2-ethylhexyl) phthalate (DEHP) (measured value up to 29.5% by weight). This phthalate may harm the health of children, causing possibly damage to their reproductive system. The product does not comply with the REACH Regulation.	Recall of the product from end users
SR/00605/25	Croatia	<b>Soother</b>  (Country of Origin: <b>China</b> )		<b>Choking, Suffocation</b> The product has small parts (teat) which may easily detach. A child may put it into their mouth and choke. In addition, the ventilation holes on the product's shield can be obstructed by the ring's position, leading to suffocation. The product does not comply with the General Product Safety Regulation nor with the European standard EN 1400.	Withdrawal of the product from the market








SR/00623/25	Poland	<b>Toy scooter</b>  (Country of Origin: <b>China</b> )		<b>Injuries</b> The diameter of the front wheels of the scooter is too small (measured value up to 119 mm), which can lead to the scooter's wheel becoming stuck on an uneven surface and the child falling, and suffering injuries. Moreover, the steering tubes are not resistant to load and may collapse during a ride. A child may fall off the scooter and suffer injuries. The product does not comply with the requirements of the Toy Safety Directive nor with the European standard EN 71-1.	Warning consumers of the risks
SR/00627/25	Slovenia	<b>Toy gun</b>  (Country of Origin: <b>China</b> )		<b>Chemical, Choking, Damage to Sight</b> The beam intensity of the red laser is too powerful (measured value up to 0.785 mW). Direct viewing of the beam could cause damage to sight. The battery compartment can be easily opened, leaving the button batteries accessible. A child may put them in the mouth, which could cause them to choke or they can be swallowed, which could cause damage to the child's gastrointestinal tract. The product does not comply with the requirements of the Toy Safety Directive nor with the European standard EN 71-1.	Recall of the product from end users
SR/00644/25	France	<b>Children's gardening set</b>  (Country of Origin: <b>China</b> )		<b>Injuries</b> A child can fall onto the teeth of the metal rake, causing injuries. The product does not comply with the requirements of the Toy Safety Directive nor with the European standard EN 71-1.	Recall of the product from end users
SR/00649/25	Sweden	<b>Flashlight</b>  (Country of Origin: <b>China</b> )		<b>Environment</b> The solders in the product have an excessive concentration of lead (measured value up to 72.6% by weight). Lead poses a risk to the environment. The product does not comply with the requirements of the Directive on the restriction of the use of certain hazardous substances in electrical and electronic equipment (RoHS 2 Directive).	Withdrawal of the product from the market

SR/00650/25	Hungary	<b>Toy slime</b>  (Country of Origin: <b>China</b> )		<b>Chemical</b> The migration of boron from the toy slime is too high (measured value up to 810 mg/kg). Ingestion or contact with an excessive quantity of boron may harm the health of children by damaging their reproductive system. The product does not comply with the requirements of the Toy Safety Directive nor with the European standard EN 71-3.	Withdrawal of the product from the market
SR/00651/25	Slovakia	<b>Toy slime set</b>  (Country of Origin: <b>China</b> )		<b>Chemical</b> The migration of boron from the toy slime is too high (measured value up to 2149 mg/kg). Ingestion or contact with an excessive quantity of boron may harm the health of children by damaging their reproductive system. The product does not comply with the requirements of the Toy Safety Directive nor with the European standard EN 71-3.	Recall of the product from end users
SR/00656/25	Hungary	<b>Toy trumpet</b>  (Country of Origin: <b>Italy</b> )		<b>Choking</b> The whistle of the trumpet can easily break, generating small parts. A small child may put them in their mouth and choke. The product does not comply with the requirements of the Toy Safety Directive nor with the European standard EN 71-1.	Withdrawal of the product from the market
SR/00657/25	Sweden	<b>Key ring with soft toy</b>  (Country of Origin: <b>Türkiye</b> )		<b>Chemical</b> The plastic material of the product has an excessive concentration of bis(2-ethylhexyl) phthalate (DEHP) (measured value up to 4.32% by weight). This phthalate may harm children's health by causing possible damage to their reproductive system. The product does not comply with the REACH Regulation.	Destruction of the product
SR/00659/25	France	<b>Fancy-dress costume</b>  (Country of Origin: <b>Hong Kong</b> )		<b>Chemical</b> The migration of chromium VI from the dress's label is too high (measured value up to 0.053 mg/kg). Chromium VI is sensitising, can trigger allergic reactions and can cause cancer. The product does not comply with the REACH Regulation nor with the European standard EN 71-3.	Recall of the product from end users

SR/00660/25	France	<b>Fancy-dress costume</b>  (Country of Origin: <b>China</b> )		<b>Chemical</b>  The migration of chromium VI from the costume's label is too high (measured value up to 0.053 mg/kg). Chromium VI is sensitising, can trigger allergic reactions and can cause cancer. The product does not comply with the REACH Regulation nor with the European standard EN 71-3.	Withdrawal of the product from the market
SR/00667/25	Germany	<b>Magnetic toy</b>  (Country of Origin: <b>China</b> )		<b>Injuries</b>  The toy contains small magnets with a high magnetic flux (measured value up to 460 kG <sup>2</sup> mm <sup>2</sup> ). If a child swallows the small magnets, they could attract one another causing intestinal blockage or perforation. The product does not comply with the requirements of the Toy Safety Directive nor with the European standard EN 71-1.	Withdrawal of the product from the market
SR/00672/25	Germany	<b>Magnetic toy</b>  (Country of Origin: <b>China</b> )		<b>Injuries</b>  The toy contains small magnets with a high magnetic flux (measured value up to 342 kG <sup>2</sup> mm <sup>2</sup> ). If a child swallows the small magnets, they could attract one another causing intestinal blockage or perforation. The product does not comply with the requirements of the Toy Safety Directive nor with the European standard EN 71-1.	Withdrawal of the product from the market

SR/00677/25	Sweden	<b>Hairclip</b>  (Country of Origin: <b>China</b> )		<b>Chemical, Environment</b>  The plastic material of the product has an and excessive concentration of bis(2-ethylhexyl) phthalate (DEHP) and short chain chlorinated paraffins (SCCPs) (measured values up to 14.78% and 0.28% by weight, respectively). DEHP may harm the health of children, causing possible damage to their reproductive system. SCCPs persist in the environment, are toxic to aquatic organisms at low concentrations and bio-accumulate in wildlife and humans, posing a risk to human health and the environment. Prolonged exposure to them through the skin may cause cancer. The product does not comply with the Reach Regulation nor with the Persistent Organic Pollutants (POP) Regulation.	Withdrawal of the product from the market
SR/00680/25	Ireland	<b>Soother set</b>  (Country of Origin: <b>China</b> )		<b>Chemical, Choking</b>  The soother can break apart, releasing small parts. A small child may put them in their mouth and choke. Moreover, the soother contains volatile compounds. These can cause irritation, headaches, organ damage, and long-term health risks. The product does not comply with the requirements of the General Product Safety Regulation nor with European standard EN 1400.	Recall of the product from end users
SR/00684/25	UK	<b>Soother</b>  (Country of Origin: <b>China</b> )		<b>Choking</b>  The teat of the soother can break or detach, releasing small parts. A small child may put it in their mouth and choke. The product does not comply with the requirements of the General Product Safety Directive.	Recall of the product from end users
SR/00688/25	UK	<b>Plush bag</b>  (Country of Origin: <b>China</b> )		<b>Choking</b>  The zipper can be easily detached from the toy. A child may put it in their mouth and choke. The product does not comply with the requirements of the Toy Safety Directive nor with the European standard EN 71.	Recall of the product from end users

SR/00691/25	UK	<b>Soft toy</b>  (Country of Origin: <b>China</b> )		<b>Choking</b> The toy has small parts (eyes and scarf) that can easily detach. A small child may put them in their mouth and choke. The product does not comply with the requirements of the Toys Safety Directive nor with the European standard EN71.	Destruction of the product
SR/00692/25	UK	<b>Baby stroller</b>  (Country of Origin: <b>China</b> )		<b>Choking</b> The product has a label that can easily detach. A small child can put it their mouth and choke. The product does not comply with the requirements of the General Product Safety Directive.	Destruction of the product
SR/00693/25	UK	<b>Baby stroller</b>  (Country of Origin: <b>China</b> )		<b>Choking</b> The label on the restraint strap can easily detach. A small child may put the label in their mouth and choke. The product does not comply with the requirements of the General Product Safety Directive nor with the European standard EN 1888-1.	Import rejected at border
SR/00408/25	Poland	<b>Plastic toy</b>  (Country of Origin: <b>China</b> )		<b>Choking</b> The toy has small parts (wheel) which may be easily detached from the toy. A child may put it into their mouth and choke. The product does not comply with the requirements of the Toy Safety Directive nor with the European standard EN 71-1.	Warning consumers of the risks
SR/00694/25	Germany	<b>Soother holder</b>  (Country of Origin: <b>China</b> )		<b>Strangulation</b> The product's cord is too long, which can become trapped during various activities of a child, leading to strangulation. The product does not comply with the General Product Safety Regulation nor with the European standard EN 12586.	Removal of this product listing by the online marketplace





SR/00696/25	France	<b>Modelling clay</b>  (Country of Origin: <b>Türkiye</b> )		<b>Chemical</b> The migration of cadmium from the toy is too high (measured value up to 1.3 mg/kg). Cadmium is harmful to human health because it accumulates in the body, can damage the kidneys and bones and it may cause cancer. The product does not comply with the requirements of the Toy Safety Directive, nor with the European standard EN 71-3.	Removal of this product listing by the online marketplace
SR/00698/25	Poland	<b>Plastic toy</b>  (Country of Origin: <b>China</b> )		<b>Choking</b> They toy has small parts (handle and wheel) which may easily detach. A child may put them into their mouth and choke. The product does not comply with the requirements of the Toy Safety Directive nor with the European standard EN 71-1.	Withdrawal of the product from the market
SR/00699/25	Hungary	<b>Toy whistle set</b>  (Country of Origin: <b>China</b> )		<b>Choking</b> The toy has small parts (whistling parts) which may easily detach. A small child may put them in their mouth and choke. The product does not comply with the requirements of the Toy Safety Directive nor with the European standard EN 71-1.	Ban on the marketing of the product and any accompanying measures
SR/00701/25	Hungary	<b>Toy slime</b>  (Country of Origin: <b>China</b> )		<b>Chemical</b> The migration of boron from the slime is too high (measured value up to 640 mg/kg). Ingestion or contact with an excessive quantity of boron may harm the health of children by damaging the reproductive system. The product does not comply with the requirements of the Toy Safety Directive nor with European standard EN 71-3.	Recall of the product from end users
SR/00702/25	Germany	<b>Soother holder</b>  (Country of Origin: <b>China</b> )		<b>Strangulation</b> The product's cord is too long, which can become trapped during various activities of a child, leading to strangulation. The product does not comply with the General Product Safety Regulation nor with the European standard EN 12586.	Recall of the product from end users





SR/00704/25	Croatia	<b>Children's nail/tattoo set</b>  (Country of Origin: <b>Hong Kong</b> )		<b>Chemical, Environment</b> The product contains an excessive amount of synthetic polymer microparticles (polyethylene terephthalate (PET)) (measured value up to 95% by weight). This microplastic is toxic to the environment and can cause cancer or be toxic for reproduction. The product does not comply with the REACH Regulation.	Destruction of the product
SR/00706/25	Sweden	<b>Toy car</b>  (Country of Origin: <b>China</b> )		<b>Chemical, Environment</b> The plastic package of the toy has an excessive concentration of bis(2-ethylhexyl) phthalate (DEHP) and short chain chlorinated paraffins (SCCPs) (measured values up to 14.8% and 0.79% by weight, respectively). DEHP may harm the health of children, causing possible damage to their reproductive system. SCCPs persist in the environment, are toxic to aquatic organisms at low concentrations and bio-accumulate in wildlife and humans, posing a risk to human health and the environment. Prolonged exposure to them through the skin may cause cancer. The product does not comply with the REACH Regulation nor with the Persistent Organic Pollutants (POP) Regulation.	Withdrawal of the product from the market
SR/00707/25	UK	<b>Children's cot</b>  (Country of Origin: <b>China</b> )		<b>Injuries</b> The cot can overturn in the rocking configuration leading to injuries to the child. The product does not comply with the requirements of the General Product Safety Directive nor with the European standard EN 1130-1.	Import rejected at border
SR/00709/25	Germany	<b>Soother holder</b>  (Country of Origin: <b>China</b> )		<b>Strangulation</b> The product's cord is too long, which can become trapped during various activities of a child, leading to strangulation. The product does not comply with the requirements of the General Product Safety Regulation nor with the European standard EN 12586.	Recall of the product from end users






SR/00710/25	Croatia	<b>Children's nail set</b>  (Country of Origin: <b>Hong Kong</b> )		<b>Chemical, Environment</b> The product contains an excessive amount of synthetic polymer microparticles (polyethylene terephthalate (PET)) (measured value up to 95% by weight). This microplastic is toxic to the environment and can cause cancer or be toxic for reproduction. The product does not comply with the REACH Regulation.	Ban on the marketing of the product and any accompanying measures
SR/00712/25	Croatia	<b>Children's nail and tattoo set</b>  (Country of Origin: <b>Hong Kong</b> )		<b>Chemical, Environment</b> The product contains an excessive amount of synthetic polymer microparticles (polyethylene terephthalate (PET)) (measured value up to 95% by weight). This microplastic is toxic to the environment and can cause cancer or be toxic for reproduction. The product does not comply with the REACH Regulation.	Destruction of the product
SR/00715/25	Sweden	<b>Battery-operated toy</b>  (Country of Origin: <b>China</b> )		<b>Environment</b> The solders in the product have an excessive concentration of lead (measured value up to 69% by weight). Lead poses a risk to the environment. The product does not comply with the requirements of the Directive on the restriction of the use of certain hazardous substances in electrical and electronic equipment (RoHS 2 Directive).	Import rejected at border
SR/00716/25	Sweden	<b>Toy hair styling kit</b>  (Country of Origin: <b>China</b> )		<b>Environment</b> The solders in the product have an excessive concentration of lead (measured value up to 84% by weight). Lead poses a risk to the environment. The product does not comply with the requirements of the Directive on the restriction of the use of certain hazardous substances in electrical and electronic equipment (RoHS 2 Directive).	Import rejected at border






SR/00717/25	Sweden	<b>Battery-operated toy</b>  (Country of Origin: <b>China</b> )		<b>Environment</b> The solders in the product have an excessive concentration of lead (measured value up to 41% by weight). Lead poses a risk to the environment. The product does not comply with the requirements of the Directive on the restriction of the use of certain hazardous substances in electrical and electronic equipment (RoHS 2 Directive).	Import rejected at border
SR/00718/25	Sweden	<b>Toy car</b>  (Country of Origin: <b>China</b> )		<b>Environment</b> The solders in the product have an excessive concentration of lead (measured value up to 71% by weight). Lead poses a risk to the environment. The product does not comply with the requirements of the Directive on the restriction of the use of certain hazardous substances in electrical and electronic equipment (RoHS 2 Directive).	Import rejected at border
SR/00719/25	Sweden	<b>Battery-operated toy</b>  (Country of Origin: <b>China</b> )		<b>Environment</b> The solders in the product have an excessive concentration of lead (measured value up to 58% by weight). Lead poses a risk to the environment. The product does not comply with the requirements of the Directive on the restriction of the use of certain hazardous substances in electrical and electronic equipment (RoHS 2 Directive).	Import rejected at border
SR/00720/25	Sweden	<b>Toy toolbox</b>  (Country of Origin: <b>China</b> )		<b>Environment</b> The solders in the product have an excessive concentration of lead (measured value up to 39% by weight). Lead poses a risk to the environment. The product does not comply with the requirements of the Directive on the restriction of the use of certain hazardous substances in electrical and electronic equipment (RoHS 2 Directive).	Import rejected at border

SR/00721/25	Sweden	<b>Toy pottery kit</b>  (Country of Origin: <b>China</b> )		<b>Environment</b> The solders in the product have an excessive concentration of lead (measured value up to 84% by weight). Lead poses a risk to the environment. The product does not comply with the requirements of the Directive on the restriction of the use of certain hazardous substances in electrical and electronic equipment (RoHS 2 Directive).	Import rejected at border
SR/00722/25	Sweden	<b>Battery-operated toy</b>  (Country of Origin: <b>China</b> )		<b>Environment</b> The solders in the product have an excessive concentration of lead (measured value up to 71% by weight). Lead poses a risk to the environment. The product does not comply with the requirements of the Directive on the restriction of the use of certain hazardous substances in electrical and electronic equipment (RoHS 2 Directive).	Import rejected at border
SR/00723/25	Sweden	<b>Battery-operated toy</b>  (Country of Origin: <b>China</b> )		<b>Environment</b> The solders in the product have an excessive concentration of lead (measured value up to 77% by weight). Lead poses a risk to the environment. The product does not comply with the requirements of the Directive on the restriction of the use of certain hazardous substances in electrical and electronic equipment (RoHS 2 Directive).	Import rejected at border
SR/00724/25	Sweden	<b>Battery-operated toy</b>  (Country of Origin: <b>China</b> )		<b>Environment</b> The solders in the product have an excessive concentration of lead (measured value up to 78% by weight). Lead poses a risk to the environment. The product does not comply with the requirements of the Directive on the restriction of the use of certain hazardous substances in electrical and electronic equipment (RoHS 2 Directive).	Import rejected at border

SR/00726/25	Sweden	<b>Toy car set</b>  (Country of Origin: <b>China</b> )		<b>Environment</b>  The solders in the product have an excessive concentration of lead (measured value up to 51% by weight). Lead poses a risk to the environment. The product does not comply with the requirements of the Directive on the restriction of the use of certain hazardous substances in electrical and electronic equipment (RoHS 2 Directive).	Import rejected at border
SR/00739/25	Latvia	<b>Toy slime</b>  (Country of Origin: <b>China</b> )		<b>Chemical</b>  The migration of boron from the toy slime is too high (measured value up to 816 mg/kg). Ingestion or contact with an excessive quantity of boron may harm the health of children by damaging the reproductive system. The product does not comply with the requirements of the Toy Safety Directive with the European standard EN 71-3.	Withdrawal of the product from the market
SR/00745/25	Belgium	<b>Soother holder</b>  (Country of Origin: <b>Germany</b> )		<b>Choking</b>  The garment fastener of the soother holder is protruding. A small child can put it in their mouth and choke. The product does not comply with the requirements of the General Product Safety Directive nor with the European standard EN 12586.	Withdrawal of the product from the market
SR/00749/25	France	<b>Oral development tool set</b>  (Country of Origin: <b>China</b> )		<b>Choking</b>  The product has protruding parts (loop and stick tool) that can get stuck in the mouth of a small child too young to sit up alone, causing choking. The product does not comply with the requirements of the Toy Safety Directive, nor with the European standard EN 71-1.	Withdrawal of the product from the market

SR/00751/25	Denmark	<b>Craft kit</b>  (Country of Origin: <b>Sweden</b> )		<b>Chemical, Choking</b>  The button batteries are easily accessible. A child may put them in the mouth, which could cause them to choke or they can be swallowed, which could cause damage to the child's gastrointestinal tract. The product does not comply with the requirements of the Toy Safety Directive nor with the European standard EN 62115.	Recall of the product from end users
SR/00758/25	UK	<b>Spider web shooter</b>  (Country of Origin: <b>China</b> )		<b>Choking</b>  The toy has small parts (suction cups at the end of the shooters) which can easily detach. A small child may put them in their mouth and choke. The product does not comply with the requirements of the Toy Safety Directive, nor with the European standard EN 71.	Import rejected at border
SR/00759/25	UK	<b>Pushchair</b>  (Country of Origin: <b>China</b> )		<b>Choking</b>  The product has a small part (label on restraint strap) which can easily detach. A young child may put it in their mouth and choke. The product does not comply with the requirements of the General Product Safety Directive.	Destruction of the product
SR/00760/25	UK	<b>Plush toy</b>  (Country of Origin: <b>China</b> )		<b>Choking</b>  The toy has small parts (nose and eyes) which can easily detach. A small child may put them in their mouth and choke. The product does not comply with the requirements of the Toy Safety Directive, nor with the European standard EN 71-1.	Destruction of the product
SR/00761/25	Italy	<b>Soft toy</b>  (Country of Origin: <b>China</b> )		<b>Chemical, Choking</b>  The plastic parts of the product have an excessive concentration of DEHP (measured value up to 15.6%). DEHP may harm the health of children, causing possible damage to their reproductive system. Moreover, the toy has small parts (eyes and nose) which can easily detach. A small child may put them in their mouth and choke. The product does not comply with the REACH Regulation nor with the Toy Safety Directive and the European standard 71-1.	Import rejected at border

SR/00771/25	France	<b>Toy tambourine</b>  (Country of Origin: <b>China</b> )		<b>Choking</b> The toy has small parts (beads) that can easily detach. A small child may put it in their mouth and choke. The product does not comply with the requirements of the Toy Safety Directive nor with the European standard EN 71-1.	Recall of the product from end users
SR/00774/25	Belgium	<b>Soother holder</b>  (Country of Origin: <b>Türkiye</b> )		<b>Choking, Strangulation</b> The product is too long and can become trapped during various activities of a child, leading to strangulation. Furthermore, the garment fastener of the soother holder is protruding. A small child can put it in their mouth and choke. The product does not comply with the General Product Safety Regulation nor with the European standards EN 12586 and 71-1.	Recall of the product from end users
SR/00778/25	Germany	<b>Soother holder</b>  (Country of Origin: <b>China</b> )		<b>Strangulation</b> The product's cord is too long, which can become trapped during various activities of a child, leading to strangulation. The product does not comply with the General Product Safety Regulation nor with the European standard EN 12586.	Recall of the product from end users
SR/00783/25	Germany	<b>Soother holder</b>  (Country of Origin: <b>China</b> )		<b>Strangulation</b> The product's cord is too long, which can become trapped during various activities of a child, leading to strangulation. The product does not comply with the requirements of the General Product Safety Regulation nor with the European standard EN 12586.	Recall of the product from end users
SR/00784/25	Germany	<b>Magnetic toy</b>  (Country of Origin: <b>China</b> )		<b>Injuries</b> The toy contains small magnets with a high magnetic flux (measured value up to 216 kG <sup>2</sup> mm <sup>2</sup> ). If a child swallows the small magnets, they could attract one another causing intestinal blockage or perforation. The product does not comply with the requirements of the Toy Safety Directive nor with the European standard EN 71-1.	Withdrawal of the product from the market

SR/00785/25	France	<b>Halloween toy torch</b>  (Country of Origin: <b>France</b> )		<b>Chemical, Choking, Damage to Sight</b> The battery compartment opens/breaks easily, making the button batteries accessible. A child could put them into their mouth, which could cause gastrointestinal injuries or lead to choking. Moreover, the blue LED light is too strong and not properly labelled. Direct viewing could cause damage to sight. The product does not comply with the requirements of the Toy Safety Directive and the General Product Safety Regulation nor with the European standard EN 62115.	Recall of the product from end users
SR/00790/25	France	<b>Toy gun</b>  (Country of Origin: <b>China</b> )		<b>Injuries</b> The kinetic energy of the projectiles fired from the toy gun is too high (measured value up to 3562 J/m2) and can lead to eye injuries. The product does not comply with the requirements of the Toy Safety Directive nor with the European standard EN 71-1.	Recall of the product from end users
SR/00794/25	Slovenia	<b>Soft toy</b>  (Country of Origin: <b>China</b> )		<b>Choking</b> The toy has protruding parts (wooden ring). A small child may put it in their mouth and choke through regurgitation. The product does not comply with the requirements of the Toy Safety Directive nor with the European standard EN 71-1.	Recall of the product from end users

## Safety Gate: the EU rapid alert system for dangerous non-food products

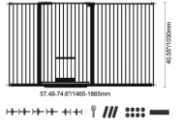

“Safety Gate”, the EU rapid alert system (formerly known as “RAPEX”), enables the rapid exchange of information between **31 European countries** and the European Commission on non-food dangerous products found on the market posing a risk to the health and safety of consumers.

A weekly overview of the alerts on those products is published in English for free on <https://ec.europa.eu/safety-gate-alerts/screen/webReport#weeklyReports>. The measures taken in the notifying country in order to restrict such products’ marketing or use can be ordered by national authorities (“compulsory measures”) or be taken directly by producers and distributors (“voluntary measures”).

The official contact points of the Member and EFTA-EEA States provide the information published in these weekly overviews. Under the terms of Annex II.10 of the General Product Safety Directive (**2001/95/EC**) responsibility for the information provided lies with the notifying party. The Commission does not take any responsibility for the accuracy of the information provided.



## Recall Summary – US Toys / Children’s Products



**CPSC Recall List (Feb 2025)**


Recall No.	Notifying Country	Product	Product Photo	Hazard / Risk	Remedy
25-122	USA	<b>UVIPC Baby Gates</b>  (Country of Origin: <b>China</b> )		<p><b>Entrapment Hazard</b></p> <p>UVIPC Baby Gates Recalled Due to Entrapment Hazard; Violation of Federal Regulations for Gates and Enclosures; Sold Exclusively on Amazon.com by Xianshengyouli</p> <p>The recalled baby gates violate the federal safety regulations for expansion gates and expandable enclosures. For the versions with a pet door, a child’s torso can fit through the secondary opening and, for the other versions that are adjustable, a child’s torso can fit through the opening between the gate slat and side wall. These violations pose an entrapment hazard to children.</p>	<p>Consumers should stop using the recalled gates immediately and contact Xianshengyouli via email at <a href="mailto:xianshengyouli@outlook.com">xianshengyouli@outlook.com</a> for information on how to dispose of the product and submit proof of destruction to obtain a full refund. Xianshengyouli and Amazon are contacting all known purchasers directly.</p>
25-123	USA	<b>Sling Carriers</b>  (Country of Origin: <b>China</b> )		<p><b>Fall Hazard</b></p> <p>Sling Carriers Recalled Due to Fall Hazard; Violation of Federal Regulations for Sling Carriers; Sold on Temu.com by Sunkids Factory</p> <p>The recalled sling carriers violate the federal safety regulations for sling carriers, including requirements for structural integrity and occupant retention, posing a fall hazard to babies.</p>	<p>Consumers should immediately stop using the recalled sling carriers, take a photo of the sling carrier, cut into pieces and email the photo to <a href="mailto:1251530867@qq.com">1251530867@qq.com</a> or message Sunkids Factory on Temu.com to receive a full refund. Sunkids Factory is contacting all known purchasers directly.</p>


25-131	USA	<p><b>SHEIN EVRYDAY Kids' Pajama Sets</b></p> <p>(Country of Origin: <b>China</b>)</p>		<p><b>Burn Hazard</b></p> <p>SHEIN Distribution Corporation Recalls Children's Pajama Sets Due to Burn Hazard; Violation of Federal Flammability Regulations; Sold exclusively at SHEIN.com</p> <p>The recalled children's pajamas violate the federal flammability regulations for children's sleepwear, posing a risk of burn injuries to children.</p>	<p>Consumers should immediately take the recalled sleepwear away from children and stop using them, and contact SHEIN for a full refund. SHEIN is contacting all known purchasers directly.</p>
25-134	USA	<p><b>6-in-1 Pounding Games</b></p> <p>(Country of Origin: <b>China</b>)</p>		<p><b>Ingestion Hazard</b></p> <p>6-in-1 Pounding Games Recalled Due to Ingestion Hazard; Violation of Federal Regulations for Magnets; Sold Exclusively on Temu.com by DMITOY</p> <p>The recalled 6-in-1 Pounding Game violates the mandatory federal regulation for magnets because it contains a magnet that can become loose, posing an ingestion hazard to children. When high-powered magnets are swallowed, the ingested magnets can attract each other, or another metal object, and become lodged in the digestive system. This can result in perforations, twisting and/or blockage of the intestines, infection, blood poisoning and death.</p>	<p>Consumers should stop using the recalled pounding games immediately and take them away from children. To receive a full refund, please dispose of the product so it is out of the reach of children, take a photo of the disposal, and send it to DMITOY via email at <a href="mailto:dmitoy202405@163.com">dmitoy202405@163.com</a> or message it to DMITOY on Temu.com. DMITOY is notifying all known purchasers directly.</p>



25-135	USA	<p><b>Youth Solitude Jackets</b></p> <p>(Country of Origin: <b>China</b>)</p>		<p><b>Strangulation Hazard</b></p> <p>AFTCO Recalls Youth Solitude Jackets with Drawstrings Due to Strangulation Hazard</p> <p>The drawstring in the hood of the recalled jackets can get caught on objects and cause death or serious injury to children due to the strangulation hazard. The jackets are in violation of the federal regulations for children's upper outerwear and present a substantial product hazard.</p>	<p>Consumers should immediately take the recalled jackets away from children and remove the drawstrings to eliminate the strangulation hazard. Consumers can either return the jacket to AFTCO for a full refund or upload a photo of the jacket without the drawstring and receive a \$25 gift card. Consumers should go to <a href="http://www.aftco.com/recall">www.aftco.com/recall</a> to participate in the recall. AFTCO is contacting all known purchasers.</p>
25-139	USA	<p><b>Rebecca's Toys &amp; Prizes Bowling Pin Sipper Cups</b></p> <p>(Country of Origin: <b>China</b>)</p>		<p><b>Risk of Lead Poisoning</b></p> <p>Nazzaro Recalls Children's Bowling Pin Sipper Cups Due to Risk of Lead Poisoning; Violation of Federal Lead Content Ban</p> <p>The red tape on the bowling pin sipper cups contains levels of lead that exceed the federal lead content ban. Lead is toxic if ingested by young children and can cause adverse health issues.</p>	<p>Consumers should immediately take the recalled cups away from children and stop using them. Contact Nazzaro for a full refund. Nazzaro is contacting all known purchasers directly.</p>

25-158	USA	<p><b>Forever 21 Children's Pajamas</b></p> <p>(Country of Origin: <b>China</b>)</p>		<p><b>Burn Hazard</b></p> <p>Forever 21 Recalls Children's Pajamas Due to Burn Hazard; Violation of Federal Flammability Regulations; Sold Exclusively by Forever 21</p> <p>The recalled pajamas violate the flammability regulations for children's sleepwear, posing a risk of burn injuries to children.</p>	<p>Consumers should stop using the recalled pajamas immediately and contact Forever 21 for a full refund. Consumers will be asked to destroy the pajamas by cutting the top and bottom pieces in half and disposing of them. Consumers must send a photo of the destroyed pajamas to <a href="mailto:recall@forever21.com">recall@forever21.com</a>. Forever 21 is contacting all known purchasers directly.</p>
25-161	USA	<p><b>P.J. Salvage Pajama Sets and Robes</b></p> <p>(Country of Origin: <b>China</b>)</p>		<p><b>Burn Hazard</b></p> <p>This recall involves P.J. Salvage Kids Checker Plush Short Sets, Fleece Pajama Sets, Smiley Plush Robes and Tie Dye Plush Sets.</p> <p>The recalled children's pajama sets and robes violate the flammability regulations for children's sleepwear, posing a risk of burn injuries and death to children.</p>	<p>Consumers should immediately take the recalled pajamas and robes away from children, destroy the garments by cutting them in half, and fill out the online registration form on the recall site <a href="http://www.pjsalvage.com/pages/recall-information">www.pjsalvage.com/pages/recall-information</a> with verification of garment destruction.</p>

25-166	USA	<p><b>Babyjoy High Chairs</b></p> <p>(Country of Origin: <b>China</b>)</p>		<p><b>Entrapment and Suffocation Hazards</b></p> <p>Costway Recalls Babyjoy High Chairs Due to Entrapment and Suffocation Hazards; Ban on Inclined Sleepers and Violation of Federal Regulations for High Chairs</p> <p>The recalled high chairs pose a fatal suffocation risk because they were marketed, intended, or designed for infant sleep, and they have an incline angle greater than 10 degrees in violation of the federal Safe Sleep for Babies Act. In addition, the high chair poses a deadly entrapment hazard because the opening between the seat and tray is large enough that a child can become entrapped in it, which is a violation of the federal regulations for high chairs.</p>	<p>Consumers should immediately stop using the recalled high chairs and contact Costway for a full refund and instructions on how to return or dispose of the high chairs. Consumers can return the product by receiving a prepaid shipping label or provide photos of the destroyed product to <a href="mailto:recall@costway.com">recall@costway.com</a>. Upon receipt of the returned product or photos of the destroyed product, Costway will issue the refund. Costway is contacting all known purchasers directly.</p>
--------	-----	--	---	---	--

25-704	USA	<p><b>Style Life Eleven Baby Loungers</b></p> <p>(Country of Origin: <b>China</b>)</p>		<p><b>Risk and Fall Hazard</b></p> <p>Wayfair Recalls Style Life Eleven Baby Loungers Due to Suffocation Risk and Fall Hazard; Violation of Federal Regulations for Infant Sleep Products; Sold Exclusively on Wayfair.com by Bespoke Clothing Valley (Royalbelle) through Zoomie Kids (Recall Alert)</p> <p>The recalled baby loungers violate the federal safety regulations for Infant Sleep Products because the sleeping pad is too thick, posing a suffocation hazard; an infant could fall out of an enclosed opening at the sides of the lounger or become entrapped; and the sides are too low to contain the infant and the loungers do not have a stand, posing a fall hazard. These violations create an unsafe sleeping environment for infants.</p>	<p>Consumers should stop using the recalled baby loungers immediately and contact Wayfair for information on how to dispose of the product to obtain a full refund. Wayfair is contacting all known purchasers directly.</p>
--------	-----	--	---	---	--

\* Source: [www.recalls.gov](http://www.recalls.gov)


## CPSC

The United States Consumer Product Safety Commission (CPSC) is an independent agency of the United States Government. To provide better service in alerting the American people to unsafe, hazardous or defective products, a “one stop shop” for U.S. Government recalls, <http://www.recalls.gov>, has been created. Members of the public may report unsafe products to CPSC by using the platform.

The recall list is divided into seven categories: Consumer Products, Motor Vehicles, Boats, Food, Medicine, Cosmetics and Environmental Products. Generally, the recall is conducted voluntarily by the company under CPSC’s Fast Track Recall program. Fast Track recalls are initiated by firms who are committed to working with CPSC to quickly announce the recall and remedy to protect consumers.



## Recall Summary – Australia Toys / Children’s Products

**ACCC Recall List (Feb 2025)**

PRA No.	Notifying Country	Product / Description	Product Photo	Hazard / Risk	Remedy
2025/20425	Australia	<p><b>Baby sling carrier</b></p> <p><b>Used to carry and distribute your baby’s weight allowing you to keep one hand free</b></p> <p><b>Available in various colours</b></p> <p><b>Affected products were sold on the Tiny Triumphs website (<a href="https://tinytriumphs.com.au/">https://tinytriumphs.com.au/</a>)</b></p>		<p><b>Risk of Death or Serious Injury</b></p> <p>Using baby slings with infants that are too young or not placing them within the sling correctly could lead to injury. The affected baby slings do not have warning information or the warning information is incorrect.</p> <p>Risk of death or serious injury to babies from falls or suffocation if the sling is not used properly. Consumers may not be aware of the safety hazards associated with this product.</p>	<p>Stop using the product immediately.</p> <p>Return the sling to the supplier using the paid postage bag.</p> <p>Contact supplier when the sling has been posted to receive a full refund.</p> <p>Contact:</p> <p>Tiny Triumphs</p> <p>Email: <a href="mailto:hi@tinytriumphs.com.au">hi@tinytriumphs.com.au</a></p>

2025/20427	Australia	<p><b>Buildable vehicles for children.</b></p> <p><b>Cement truck, blue &amp; white in colour, 106 pieces.</b></p> <p><b>Express courier truck, blue &amp; white in colour, 104 pieces.</b></p> <p><b>Fire engine, red in colour, 106 pieces.</b></p> <p><b>Brand Construct It!</b></p>		<p><b>Missing Warnings</b></p> <p>The product does not comply with the mandatory standards for products containing button/coin batteries.</p> <p>The button/coin batteries are not adequately secured and are accessible by young children.</p> <p>The product does not include the required warning information.</p> <p>There is a risk of choking, severe internal burn injuries or death to young children if they gain access to the button/coin batteries and swallow or place them inside their body.</p> <p>Severe or fatal injuries can happen in 2 hours or less.</p>	<p>Stop using the product immediately and place out of reach of children.</p> <p>Return the product to the place of purchase for a full refund.</p> <p>Contact:</p> <p>BMS Brands Pty Ltd</p> <p>Call: 02 9634 7224 – Monday-Friday 9:00 am-5:00 pm.</p> <p>Email: <a href="mailto:sales@bmsbrands.com.au">sales@bmsbrands.com.au</a></p>
2025/20431	Australia	<p><b>Foldable baby stroller.</b></p>		<p><b>Risk of Serious Injury or Death</b></p> <p>This stroller does not comply with the mandatory standard for prams and strollers. There is no tether strap and the brake control is not red.</p> <p>Risk of serious injury or death to babies or young children due to the missing safety features.</p>	<p>Stop using these strollers immediately.</p> <p>Contact Little Infants Australia to arrange for return of the product and a replacement product or store credit.</p> <p>Contact:</p> <p>Little Infants AU</p> <p>Call: 0416 037 693</p> <p>Email: <a href="mailto:support@littleinfants.com.au">support@littleinfants.com.au</a></p>

2025/20433	Australia	<p><b>Pet pool.</b></p> <p><b>Sold in various colours and sizes:</b></p> <p><b>Party Watermelon (80cm, 120cm, 160cm)</b></p> <p><b>Party Beach Ball (80cm, 120cm, 160cm)</b></p> <p><b>Party Summer Blue (80cm, 120cm, 160cm)</b></p> <p><b>Party Pride (80cm, 120cm, 160cm)</b></p> <p><b>Pawtton Print (80cm, 120cm, 160cm)</b></p>		<p><b>Missing Warnings</b></p> <p>The products do not comply with the mandatory standard for portable swimming pools. The products do not have the required warning signs and messages.</p> <p>Risk of drowning and death if a child enters the pool unsupervised.</p>	<p>Stop using the products immediately.</p> <p>Contact the place of purchase to arrange for the return of the product and a full refund.</p> <p>Contact Decor Innovations if you have sold or gifted the product to another person.</p> <p>Contact:</p> <p>Decor Innovations Pty Ltd</p> <p>Call:</p> <p>02 9738 1118</p> <p>Email:</p> <p>Customerservice@decorinnovations.com.au</p>
2025/20438	Australia	<p><b>Boys flannelette pyjamas:</b></p> <p><b>Various patterns Sizes 3-7 and 8-14.</b></p> <p><b>Barcodes 9325365036800, 9325365042580;</b></p> <p><b>Various girls flannelette pyjamas:</b></p> <p><b>Various patterns Sizes 3-7 and 8-14.</b></p> <p><b>Barcodes 9325365036817, 9325365036794</b></p>		<p><b>Hazard of Serious Burn Injuries</b></p> <p>These products do not comply with the mandatory standard for nightwear for children.</p> <p>The warning labels do not contain the required information.</p> <p>There is a risk of serious burn injuries if exposed to a heat or flame source.</p> <p>Consumers may not be aware of this hazard.</p>	<p>Stop using the pyjamas immediately.</p> <p>Return the pyjamas to the place of purchase, or contact Rylor Pty Ltd, for a full refund.</p> <p>Contact:</p> <p>Rylor Pty Ltd</p> <p>Call:</p> <p>02 9053 7327, 9:00 am to 4:00 pm, Monday to Friday.</p> <p>E-mail:</p> <p><a href="mailto:mark@rylor.com.au">mark@rylor.com.au</a></p>

2025/20440	Australia	<p><b>Wooden ring with coloured ribbons and bells attached.</b></p>		<p><b>Strangulation Hazard</b></p> <p>This product does not comply with the mandatory standard for toys for children up to and including 36 months of age.</p> <p>The product contains small parts and the ribbons are a strangulation hazard.</p> <p>Risk of serious injury or death from choking on the bells or strangulation from the ribbons.</p>	<p>Stop using the product immediately.</p> <p>Return it to the supplier for a refund of the purchase price.</p> <p>Contact:</p> <p>Open Hand Learning</p> <p>Email: info@openhandlearning.com.au</p>
2025/20444	Australia	<p><b>Slap band to be worn around the wrist in a dinosaur shape.</b></p> <p><b>Various colours.</b></p>		<p><b>Risk of Serious Injury Including Cuts</b></p> <p>The casing may degrade or split, exposing the inner metal component of the Dino slap band.</p> <p>Risk of serious injury including cuts if the metal is exposed during play.</p> <p>An incident causing this injury has occurred.</p>	<p>Stop using the bands immediately and place them out of reach of children.</p> <p>Consumers to return the band to their nearest Best&amp;Less store for a full refund.</p> <p>Contact:</p> <p>Best&amp;Less</p> <p>Call: 1300 135 766</p> <p>Email: customerservice@bestandless.com.au</p>

## Australian Product Safety System

The Australian product safety system is set up to maximize the safety of goods through the cooperation of consumers, businesses and agencies. This policy sets out the principles adopted by the Australian Competition and Consumer Commission (ACCC) for prioritizing and addressing product safety risks.

Under the Australian Consumer Law, a responsible Minister can order a compulsory recall when there are hazards on the products. A voluntary recall could be conducted to remove the product from the marketplace when the suppliers become aware of unsafe or defective products.



The ACCC administers a national recalls system for recalls of specific and general consumer products, and publishes all product recalls on the website <https://www.productsafety.gov.au/recalls>.

STC (Hong Kong Standards and Testing Centre) is a not-for-profit, independent testing, inspection and certification organization. With a global network of ISO/IEC 17025 accredited testing laboratories and over 60 years of experience in consumer product testing, we can meet your conformity assessment needs with highly efficient and reliable service. Our testing scope and capabilities related to toys and children's products include but are not limited to:

### EU Requirements

- EN 71
- Phthalates (EC) no. 1907/2006
- Nickel Release (EC) no. 1907/2006
- Total Cadmium (EEC) no. 91/338
- Lead in Jewellery product (EC) no. 836/2012
- Azo-dye (EC) no. 1907/2006
- Bisphenol-A (2014/81/EU)
- DMF (Dimethyl fumarate) (EU) no. 2011/135
- Flame retardants TCEP, TCPP, TDCP (2014/79/EU)
- Package Waste Directive (94/62/EC)

### US & Canada Requirements

- ASTM F963
- CPSIA
- California Proposition 65
- 16 CFR 1501
- ASTM F2923 (Children's jewellery)
- ASTM F2999 (Adult's jewellery)
- US Toxic in Packaging Clearinghouse (TPCH)
- CCPSA - Toys Regulations (SOR/2011-17)

### Japan Requirements

- Japan Toy Safety Standard (ST)
- Japan Food Sanitation Law (JFSL)

### Australia Requirements

- AS/NZS 8124
- Consumer Protection Notice No. 6 of 2010 - DEHP

#### FOR MORE DETAILS, PLEASE CONTACT US:

Hong Kong: [hktcd@stc.group](mailto:hktcd@stc.group)  
Changzhou: [czstc@stc.group](mailto:czstc@stc.group)  
U.S.A.: [usenquiry@stc.group](mailto:usenquiry@stc.group)

Guangdong: [gdtcd@stc.group](mailto:gdtcd@stc.group)  
Vietnam: [vnstc@stc.group](mailto:vnstc@stc.group)  
Germany: [grstc@stc.group](mailto:grstc@stc.group)

Shanghai: [shtcd@stc.group](mailto:shtcd@stc.group)  
Japan: [jpo@stc.group](mailto:jpo@stc.group)

