












Recall Summary – European Toys






EU Safety Gate Alerts (Dec 2024)

Alert No.	Notifying Country	Product	Product Photo	Hazard / Risk	Measures Adopted
A11/00155/24	Ireland	Ride-on toy (Country of Origin: China)		Burns The printed circuit board can easily detach, which may cause the product to overheat and components to melt during use. The child or bystanders can suffer burns. The product does not comply with the requirements of the Toy Safety Directive nor with the European standard EN 62115.	Recall of the product from end users
A11/00156/24	France	Soft toy (Country of Origin: China)		Choking The fibrous stuffing material of the toy is easily accessible due to the weakness of the seams. A small child may put the filling material in their mouth and choke. The product does not comply with the requirements of the Toy Safety Directive nor with the European standard EN 71-1.	Withdrawal of the product from the market
A11/00159/24	Germany	Soft toy (Country of Origin: China)		Choking The zip fastener allows access to the stuffing material. A child may put the filling material in their mouth and choke. The product does not comply with the requirements of the Toy Safety Directive nor with the European standard EN 71-1.	Recall of the product from end users
A11/00170/24	Poland	Soft toy (Country of Origin: China)		Choking The fibrous stuffing material of the toy is easily accessible due to weakness of certain seams. A small child may put the filling material in their mouth and choke. The product does not comply with the requirements of the Toy Safety Directive nor with the European standard EN 71-1.	Withdrawal of the product from the market

A12/03357/24	Slovakia	Children´s cot (Country of Origin: Latvia)		Injuries, Strangulation The snag points of the cot protrude. Cords (from clothing or a soother holder) could get entangled around a snag point, leading to strangulation. The product does not comply with the requirements of the General Product Safety Directive nor with the European standard EN 716-1.	Withdrawal of the product from the market
A12/03361/24	Czechia	Toy mobile phone (Country of Origin: China)		Environment The product has excessive concentrations of lead and cadmium (measured values up to 79.1 % and 0.26% by weight, respectively). Lead and cadmium pose a risk to the environment. The product does not comply with the requirements of the Directive on the restriction of the use of certain hazardous substances in electrical and electronic equipment (RoHS 2 Directive).	Withdrawal of the product from the market
A12/03374/24	France	Finger paint (Country of Origin: Spain)		Chemical The white, blue, red and black paints have an excessive concentration of methylisothiazolinone (MI) (measured value up to 2.8 mg/kg). MI causes severe skin burns and eye damage (if in contact with eyes), and may cause an allergic skin reaction. In addition, the green paint has an excessive concentration of formaldehyde (measured value up to 0.25 mg/kg). Formaldehyde is a skin sensitizer and can trigger allergic reactions and may cause cancer. The product does not comply with the requirements of the Toy Safety Directive nor with the European standards EN 71-3 and EN 71-7.	Withdrawal of the product from the market

A12/03411/24	Denmark	Fancy-dress hairband (Country of Origin: Denmark)		Chemical, Choking The battery compartment can be easily opened, leaving the batteries accessible. A child could put them in their mouth, which, if swallowed, could cause damage to the child's gastrointestinal tract or choking. The product does not comply with the requirements of the Toy Safety Directive nor with the European standard EN 71-1.	Recall of the product from end users
A12/03419/24	Hungary	Toy slime (Country of Origin: China)		Chemical The product has an excessive concentration of dibutyl phthalate (DBP) and bis(2-ethylhexyl) phthalate (DEHP) (measured values up to 0.37% and 22% by weight, respectively). These phthalates may harm the health of children, causing possible damage to their reproductive system. The product does not comply with the REACH Regulation.	Withdrawal of the product from the market
A12/03423/24	Austria	Toy camera (Country of Origin: Unknown)		Strangulation The toy has a long strap to carry it around the neck. This strap can become trapped around the neck area during various activities of a child, leading to strangulation. The product does not comply with the requirements of the Toy Safety Directive nor with the European standard EN 71-1.	Removal of this product listing by the online marketplace
A12/03429/24	Slovakia	Children's cot (Country of Origin: Poland)		Entrapment, Injuries, Strangulation The slats in the bottom may break easily. Due to insufficient depth of the assembly holes, the columns on the side may also break easily, creating accessible holes where the limbs or head of a child could get stuck. This could lead to injuries or strangulation. The product does not comply with the requirements of the General Product Safety Directive nor with the European standard EN 716-1.	Recall of the product from end users






A12/03433/24	Slovakia	Children's cot (Country of Origin: Poland)		Entrapment, Injuries, Strangulation The strength of the locking system of the movable side panel is insufficient. In addition, the distance between the footholds and the top of the cot is not sufficient. The child could easily get out of the bed, leading to falls and injuries. The columns on the side of the bed can easily break, resulting in wider gaps where the limbs or head of the child can get entrapped, leading to injuries or strangulation. The product does not comply with the requirements of the General Product Safety Directive nor with European standard EN 716-1.	Recall of the product from end users
A12/03434/24	Germany	Baby book (Country of Origin: United Kingdom)		Choking The product has small parts (collar eyelets and beads) that can be easily detached. A small child may put them in their mouth and choke. The product does not comply with the requirements of the Toy Safety Directive nor with the European standard EN 71-1.	Removal of this product listing by the online marketplace
A12/03435/24	Germany	Baby book (Country of Origin: China)		Choking The product has small parts (eyes, snap fasteners, neck-band eye and beads) that can be easily detached. A small child may put them in their mouth and choke. The product does not comply with the requirements of the Toy Safety Directive nor with the European standard EN 71-1.	Removal of this product listing by the online marketplace
A12/03436/24	Germany	Baby book (Country of Origin: China)		Choking The product has small parts (eyes, snap fasteners and beads) that can be easily detached. A small child may put them in their mouth and choke. The product does not comply with the requirements of the Toy Safety Directive nor with the European standard EN 71-1.	Removal of this product listing by the online marketplace

A12/03444/24	Germany	Baby book (Country of Origin: China)		Choking The product has small parts, (glued eyes, pointer snap-fit fastener and collar with snap hook) that can be easily detached. A small child may put them in their mouth and choke. The product does not comply with the requirements of the Toy Safety Directive nor with the European standard EN 71-1.	Removal of this product listing by the online marketplace
A12/03446/24	Denmark	Plastic toy (Country of Origin: Unknown)		Choking The toy has protruding parts. A small child may put them in their mouth and choke. The product does not comply with the requirements of the Toy Safety Directive nor with the European standard EN 71-1.	Removal of this product listing by the online marketplace
A12/03447/24	Denmark	Plastic toy (Country of Origin: Unknown)		Choking The toy has small parts (figures) that can easily detach. As a consequence, a small child may put them in their mouth and choke on them. The product does not comply with the requirements of the Toy Safety Directive, nor with the European standard EN 71-1.	Ban on the marketing of the product and any accompanying measures
A12/03448/24	Slovakia	Children's cot (Country of Origin: Poland)		Cuts, Entrapment, Injuries, Strangulation The cot has sharp accessible edges on a plastic cover on the upper edge of the moving side. These could cause cuts. There are also accessible gaps on the moving side of the cot. The fingers of a child could be trapped and the child may be injured. In addition, the locking system on the movable side does not meet the requirements in the lowest position. Clothes of the child could also get entrapped, leading to strangulation. The product does not comply with the requirements of the General Product Safety Directive nor with European standard EN 716-1.	Warning consumers of the risks
A12/03456/24	Hungary	Plastic doll set (Country of Origin: China)		Chemical The product has an excessive concentration of di-2-ethylhexyl phthalate (DEHP) and dibutyl phthalate (DBP) (measured values up to 0.74% and 17% by weight). These phthalates may harm the health of children, causing possible damage to their reproductive system. The product does not comply with the REACH Regulation.	Withdrawal of the product from the market

A12/03458/24	Hungary	Bath toy (Country of Origin: China)		Choking Small plastic parts (squeaking elements) can easily detach from the toy. A small child may put them in their mouth and choke. The product does not comply with the requirements of the Toy Safety Directive, nor with the European standard EN 71-1.	Recall of the product from end users
A12/03464/24	Poland	Toy stamps (Country of Origin: China)		Chemical The rubber part of the stamp contains an excessive amount of bis(2-ethylhexyl) phthalate (DEHP) (measured value up to 0.693% by weight). This phthalate may harm the health of children, causing possible damage to their reproductive system. The product does not comply with the REACH Regulation.	Withdrawal of the product from the market
A12/03479/24	Hungary	Plastic doll (Country of Origin: China)		Chemical The product has an excessive concentration of bis(2-ethylhexyl) phthalate (DEHP) and dibutyl phthalate (DBP) (measured values up to 0.38% and 0.64% by weight, respectively). These phthalates may harm the health of children, causing possible damage to their reproductive system. The product does not comply with the REACH Regulation.	Recall of the product from end users
A12/03481/24	Hungary	Plastic doll (Country of Origin: China)		Chemical The product has an excessive concentration of bis(2-ethylhexyl) phthalate (DEHP) and dibutyl phthalate (DBP) (measured values up to 20% and 0.51% by weight, respectively). These phthalates may harm the health of children, causing possible damage to their reproductive system. The product does not comply with the REACH Regulation.	Withdrawal of the product from the market
A12/03483/24	Hungary	Plastic doll (Country of Origin: China)		Chemical The product contains an excessive amount of bis(2-ethylhexyl) phthalate (DEHP) (measured value up to 33% by weight). This phthalate may harm the health of children, causing possible damage to their reproductive system. The product does not comply with the REACH Regulation.	Recall of the product from end users






A12/03484/24	Hungary	Plastic doll (Country of Origin: China)		Chemical The product has an excessive concentration of bis(2-ethylhexyl) phthalate (DEHP) and dibutyl phthalate (DBP) (measured values up to 31% and 0.4% by weight, respectively). These phthalates may harm the health of children, causing possible damage to their reproductive system. The product does not comply with the REACH Regulation.	Recall of the product from end users
A12/03488/24	Poland	Plastic toy (Country of Origin: China)		Chemical The plastic material of the product has an excessive concentration of dibutyl phthalate (DBP) and diisobutyl phthalate (DIBP) (measured values up to 12.4% and 1.91% by weight respectively). These phthalates may harm the health of children, possibly by causing damage to the reproductive system. The product does not comply with the REACH Regulation.	Warning consumers of the risks
A12/03503/24	Hungary	Toy scooter (Country of Origin: China)		Injuries The steering tube fixing mechanism is not sufficiently stable. The wheels are too small and could get stuck in holes in the ground. These could cause the child to lose balance and fall off, leading to injuries. The product does not comply with the requirements of the Toy Safety Directive nor with the European standard EN 71-1.	Withdrawal of the product from the market
A12/03513/24	Germany	Baby book (Country of Origin: China)		Choking The product includes loose small pieces and also has small parts (glued-on eyes) that can easily detach. A small child may put them in their mouth and choke. The product does not comply with the requirements of the Toy Safety Directive nor with the European standard EN 71-1.	Removal of this product listing by the online marketplace


A12/03556/24	Hungary	Bath toy (Country of Origin: China)		Choking Small plastic parts (squeaking elements) may easily detach from the toy. A small child may put them in their mouth and choke. The product does not comply with the requirements of the Toy Safety Directive nor with the European standard EN 71-1.	Withdrawal of the product from the market
A12/03579/24	Hungary	Plastic doll (Country of Origin: China)		Chemical The product has an excessive concentration of bis(2-ethylhexyl) phthalate (DEHP) and dibutyl phthalate (DBP) (measured values up to 24% and 0.22% by weight, respectively). These phthalates may harm the health of children, causing possible damage to their reproductive system. The product does not comply with the REACH Regulation.	Withdrawal of the product from the market
A12/03587/24	France	Plastic toy (Country of Origin: China)		Chemical, Choking The battery compartment can be easily opened without the aid of a tool, leaving button batteries accessible. A child may put the batteries in their mouth, which could cause damage to the child's gastrointestinal tract or choking, if swallowed. The product does not comply with the requirements of the Toy Safety Directive nor with the European standard EN 62115.	Withdrawal of the product from the market
A12/03606/24	Slovakia	Toy slime (Country of Origin: China)		Chemical The migration of boron from the toy slime is too high (measured value up to 770 mg/kg). Ingestion or contact with an excessive quantity of boron may harm the health of children by damaging their reproductive system. The product does not comply with the requirements of the Toy Safety Directive nor with the European standard EN 71-3.	Recall of the product from end users





A12/03608/24	Slovakia	Toy slime (Country of Origin: China)		Chemical The migration of boron from the toy slime is too high (measured value up to 550 mg/kg). Ingestion or contact with an excessive quantity of boron may harm the health of children by damaging their reproductive system. The product does not comply with the requirements of the Toy Safety Directive nor with the European standard EN 71-3.	Withdrawal of the product from the market
A12/03628/24	Slovakia	Toy slime (Country of Origin: China)		Chemical The migration of boron from the toy slime is too high (measured value up to 520 mg/kg). Ingestion or contact with an excessive quantity of boron may harm the health of children by damaging their reproductive system. The product does not comply with the requirements of the Toy Safety Directive nor with the European standard EN 71-3.	Recall of the product from end users
A12/03641/24	Slovakia	Toy slime (Country of Origin: China)		Chemical The migration of boron from the toy slime is too high (measured value up to 500 mg/kg). Ingestion or contact with an excessive quantity of boron may harm the health of children by damaging their reproductive system. The product does not comply with the requirements of the Toy Safety Directive nor with the European standard EN 71-3.	Recall of the product from end users
A12/03642/24	France	Set of toy cars (Country of Origin: China)		Choking The product has a small part (wheel) which can easily detach. A small child may put it in their mouth and choke. The product does not comply with the requirements of the Toy Safety Directive nor with the European standard EN 71-1.	Recall of the product from end users
A12/03647/24	Poland	Plastic toy (Country of Origin: China)		Choking The toy may break easily generating small plastic parts. A child may put them into their mouth and choke. The product does not comply with the requirements of the Toy Safety Directive nor with the European standard EN 71-1.	Withdrawal of the product from the market






A12/03648/24	Germany	Toy projector (Country of Origin: Unknown)		Damage to sight The laser beam is too powerful (measured value up to 4.27 mW) and the product is not adequately labelled. Direct viewing of the laser beam could cause damage to sight. The product does not comply with the requirements of the Toy Safety Directive nor with the European standards EN 60825-1 and EN 62115.	Removal of this product listing by the online marketplace
A12/03655/24	Austria	Bath toy (Country of Origin: China)		Choking The toy has a small part (flipper) which can easily detach. A small child may put it in their mouth and choke. Product is sold online, in particular via Wish. The product does not comply with the requirements of the Toy Safety Directive nor with the European standard EN 71-1.	Removal of this product listing by the online marketplace
A12/03657/24	France	Soft toy (Country of Origin: China)		Choking The product has small parts (nose) that can easily detach. Additionally, the fibrous stuffing material of the toy is easily accessible due to the weakness of the seams. A small child may put the small part or the filling material in their mouth and choke. The product does not comply with the requirements of the Toy Safety Directive nor with the European standard EN 71-1.	Withdrawal of the product from the market
A12/03127/24	Estonia	Soother (Country of Origin: Poland)		Choking The handle of the product, which is a small part, can easily break. A small child may put it in their mouth and choke. The product does not comply with the requirements of the General Product Safety Directive nor with the European standard EN 1400.	Recall of the product from end users
A12/03661/24	Austria	Plastic toy (Country of Origin: China)		Choking The product has small parts (suction cups). A small child can put them in their mouth and choke. The product does not comply with the requirements of the Toy Safety Directive nor with the European standard EN 71-1.	Removal of this product listing by the online marketplace

A12/03665/24	France	Toy wands (Country of Origin: China)		Chemical, Choking The handle of the wand can be easily break, making the button batteries inside accessible. A child may put them in their mouth, which could cause them to choke or they can be swallowed, which could cause damage to the child's gastrointestinal tract. The product does not comply with the requirements of the Toy Safety Directive nor with the European standard EN 62115.	Withdrawal of the product from the market
A12/03678/24	Poland	Soft toy (Country of Origin: China)		Choking The zipper can be easily detached from the toy. Moreover, the fibrous stuffing material of the toy is easily accessible due to the zipper. A child may put the zipper or the fibrous stuffing material in their mouth and choke. The product does not comply with the requirements of the Toy Safety Directive nor with the European standard EN 71-1.	Warning consumers of the risks
A12/03687/24	Austria	Children's slide (Country of Origin: China)		Injuries, Strangulation A child can climb on to the basketball hoop and fall through, injuring themselves. Moreover, a child's head can be caught in the basketball hoop, creating a risk of strangulation. The product does not comply with the requirements of the Toy Safety Directive nor with European standards EN 71-1 and EN 71-8.	Removal of this product listing by the online marketplace
A12/03689/24	Austria	Climbing tower with a slide (Country of Origin: China)		Injuries, Strangulation The slide/climbing board is secured only by insertion into a stabiliser bar. When used by a child, the board can fall on another child present under it, injuring them. Moreover, a child can climb on the rung/ladder and slip through the rungs with both legs, causing a risk of strangulation. The product does not comply with the requirements of the Toy Safety Directive nor with the European standards EN 71-1 and EN 71-8.	Removal of this product listing by the online marketplace






A12/03690/24	Latvia	Toy slime (Country of Origin: China)		Chemical The migration of boron from the toy slime is too high (measured value up to 600 mg/kg). Ingestion or contact with an excessive quantity of boron may harm the health of children by damaging their reproductive system. The product does not comply with the requirements of the Toy Safety Directive nor with the European standard EN 71-3.	Recall of the product from end users
A12/03691/24	Denmark	Teether (Country of Origin: Unknown)		Choking The toy has a protruding part that can get stuck in the mouth of a small child, causing choking. The product does not comply with the requirements of the Toy Safety Directive nor with the European standard EN 71-1.	Recall of the product from end users
A12/03702/24	France	Playmat (Country of Origin: China)		Choking The product has small parts (internal pieces of numbers and letters) that can easily detach. A small child may put them in their mouth and choke. The product does not comply with the requirements of the Toy Safety Directive nor with the European standard EN 71-1.	Warning consumers of the risks
A12/03706/24	Poland	Plastic swing seat (Country of Origin: China)		Injuries The product has accessible openings and holes, in which children can become trapped and suffer injuries. The product does not comply with the requirements of the Toy Safety Directive nor with the European standard EN 71-8.	Withdrawal of the product from the market
INFO/00135/24	France	Toy slime (Country of Origin: China)		Chemical The migration of boron from the toy slime is too high (measured value up to 300 mg/kg). Ingestion or contact with an excessive quantity of boron may harm the health of children by damaging their reproductive system. The product does not comply with the requirements of the Toy Safety Directive nor with the European standard EN 71-1 and 71-3.	Destruction of the product


INFO/00139/24	Hungary	Baby walker (Country of Origin: China)		Injuries The strength of the baby walker is inadequate and there is no proper protection against falls from stairs. This can cause injuries to a child. The product does not comply with the requirements of the General Product Safety Directive nor with the European standard EN 1273.	Recall of the product from end users
OR/00171/24	Croatia	Children's high chair (Country of Origin: Poland)		Entrapment There is a space between the foldable table and the leg separator of the high chair. A child's finger can get entrapped in this space. The product does not comply with the requirements of the General Product Safety Directive nor with the European standard EN 14988.	Withdrawal of the product from the market
OR/00173/24	Slovakia	Children's high chair (Country of Origin: China)		Injuries The strength of the passive crotch restraint system is insufficient. The child could easily put both legs into one of the leg openings, which can lead to falls and injuries, such as concussions or fractures. The product does not comply with the requirements of the General Product Safety Directive nor with the European standard EN 14988.	Recall of the product from end users
OR/00174/24	Slovakia	Children's high chair (Country of Origin: Czechia)		Injuries The height locking system strength is insufficient and can fail. This can lead the child to fall from the chair during long-term use of the chair. This creates a risk of injuries for the child. The product does not comply with the requirements of the General Product Safety Directive nor with the European standard EN 14988.	Withdrawal of the product from the market
OR/00175/24	Croatia	Soft toy (Country of Origin: China)		Choking The fibrous stuffing material of the toy is easily accessible due to the weakness of certain seams. A small child may put the filling material in their mouth and choke. The product does not comply with the requirements of the Toy Safety Directive nor with the European standard EN 71-1.	Ban on the marketing of the product and any accompanying measures

OR/00176/24	Slovakia	Children's high chair (Country of Origin: China)		Injuries The strength of the passive crotch restraint system is insufficient. The child could easily put both legs into one of the leg openings, which can lead to falls and injuries, such as concussions or fractures. The product does not comply with the requirements of the General Product Safety Directive nor with the European standard EN 14988.	Warning consumers of the risks
OR/00181/24	Slovakia	Pushchair (Country of Origin: China)		Injuries The parking brake of the pushchair does not work adequately. A parent/carer may lose control over the pushchair, leading to injuries to the child. The product does not comply with the requirements of the General Product Safety Directive nor with the European standard EN 1888.	Withdrawal of the product from the market
SR/03714/24	Latvia	Toy slime (Country of Origin: Hong Kong)		Chemical The migration of boron from the toy is too high (measured value up to 780 mg/kg). Ingestion or contact with an excessive quantity of boron may harm the health of children by damaging their reproductive system. The product does not comply with the requirements of the Toy Directive nor with the European standard EN 71-3.	Ban on the marketing of the product and any accompanying measures
SR/03719/24	Lithuania	Toy slime (Country of Origin: China)		Chemical The migration of boron from the toy slime is too high (measured value up to 580 mg/kg). Ingestion or contact with an excessive quantity of boron may harm the health of children by damaging their reproductive system. The product does not comply with the requirements of the Toy Safety Directive nor with the European standard EN 71-3.	Withdrawal of the product from the market

SR/03720/24	Latvia	Toy slime (Country of Origin: China)		Chemical The migration of boron from the toy slime is too high (measured value up to 600 mg/kg). Ingestion or contact with an excessive quantity of boron may harm the health of children by damaging their reproductive system. The product does not comply with the requirements of the Toy Safety Directive nor with the European standard EN 71-3.	Withdrawal of the product from the market
SR/03727/24	France	Toy maracas (Country of Origin: Unknown)		Choking The toy has protruding parts. A small child may put them in their mouth and choke through regurgitation. The product does not comply with the requirements of the Toy Safety Directive nor with the European standard EN 71-1.	Withdrawal of the product from the market
SR/03732/24	France	Fancy-dress costume (Country of Origin: China)		Burns The fabric ribbon forming a bow on the hat is highly flammable and the flame propagation is too high on the white textile of the dress. The costume may catch fire if worn close to an ignition source, resulting in burns. The product does not comply with the requirements of the Toy Safety Directive nor with the European standard EN 71-2.	Recall of the product from end users
SR/03733/24	France	Soft toy (Country of Origin: China)		Choking The product has a small part (left eye of the soft toy) that can easily detach. A small child can put it in their mouth and choke. The product does not comply with the requirements of the Toy Safety Directive nor with the European standard EN 71-1.	Recall of the product from end users
SR/03734/24	Denmark	Toy rattle (Country of Origin: Unknown)		Choking The toy has a protruding part that can get stuck in the mouth of a small child, causing choking. The product does not comply with the requirements of the Toy Safety Directive nor with the European standard EN 71-1.	Ban on the marketing of the product and any accompanying measures

SR/03736/24	Latvia	Toy slime (Country of Origin: China)		Chemical The migration of boron from the toy is too high (measured value up to 740 mg/kg). Ingestion or contact with an excessive quantity of boron may harm the health of children by damaging their reproductive system. The product does not comply with the requirements of the Toy Safety Directive nor with the European standard EN 71-3.	Ban on the marketing of the product and any accompanying measures
SR/03739/24	Finland	Soft toy (Country of Origin: China)		Choking Small parts (eyes) can easily detach. A small child may put them in their mouth and choke. The product does not comply with the requirements of the Toy Safety Directive nor with the European standard EN 71-1.	Import rejected at border
SR/03744/24	Lithuania	Plastic toy set (Country of Origin: China)		Choking The toy set contains small parts (foam balls). A small child may put them in their mouth and choke. The product does not comply with the requirements of the Toy Safety Directive nor with the European standard EN 71-1.	Withdrawal of the product from the market
SR/03749/24	Cyprus	High chair (Country of Origin: Greece)		Injuries The high chair is not sufficiently stable and can easily tip over. A child may fall and suffer injuries. The product does not comply with the requirements of the General Product Safety Directive nor with the European standard EN 14988.	Withdrawal of the product from the market
SR/03750/24	Germany	Children's high chair (Country of Origin: China)		Entrapment, Injuries, Strangulation The product has only a crotch restraint on the belt, and not between the seat and the bar. Consequently, if the belt is not used, the child might slip through the opening between the bar and the seat and fall, resulting in injuries, or become trapped with the chest, head or neck between the tray and the seat, resulting in strangulation or entrapment. In addition, the high chair is not sufficiently stable and may tip over while the child is seated. The product does not comply with the requirements of the General Product Safety Directive nor with the European standard EN 14988.	Warning consumers of the risks

SR/03751/24	Austria	Indoor swing seat (Country of Origin: China)		Choking The swing has small parts (wooden balls). A small child can put them in their mouth and choke. The product does not comply with the requirements of the Toy Safety Directive nor with European standard EN 71-1.	Removal of this product listing by the online marketplace
SR/03752/24	Latvia	Push-along toy (Country of Origin: Poland)		Choking Small parts can easily detach (blue plastic bell). As a consequence, a small child may put them in their mouth and choke. The product does not comply with the requirements of the Toy Safety Directive nor with the European standard EN 71-1.	Recall of the product from end users
SR/03757/24	Austria	Swing (Country of Origin: Unknown)		Choking Small parts can easily detach (hook on the buckle fastener and adjustment clip on the seat strap). As a consequence, a small child may put them in their mouth and choke. The product does not comply with the requirements of the Toy Safety Directive nor with European standard EN 71-1.	Removal of this product listing by the online marketplace
SR/03765/24	Lithuania	Toy dog (Country of Origin: China)		Choking The collar of the toy dog can easily break, resulting in small parts (collar bell). A small child may put them in their mouth and choke. The product does not comply with the requirements of the Toy Safety Directive nor with the European standard EN 71-1.	Withdrawal of the product from the market
SR/03769/24	Germany	Children's high chair (Country of Origin: China)		Injuries The high-chair is not sufficiently stable and may tip over while the child is seated. The product does not comply with the requirements of the General Product Safety Directive nor with the European standard EN 14988.	Recall of the product from end users

SR/03771/24	Finland	Soft toy (Country of Origin: China)		Choking, Injuries, Strangulation Small parts can easily detach (eyes, nose, suction cup). As a consequence, a small child may put them in their mouth and choke. In addition, the product bears an excessively long cord that can become trapped during various activities of a child, leading to strangulation or injuries. The product does not comply with the requirements of the Toy Safety Directive nor with the European standard EN 71-1.	Import rejected at border
-------------	---------	---	---	--	---------------------------

Safety Gate: the EU rapid alert system for dangerous non-food products



“Safety Gate”, the EU rapid alert system (formerly known as “RAPEX”), enables the rapid exchange of information between **31 European countries** and the European Commission on non-food dangerous products found on the market posing a risk to the health and safety of consumers.


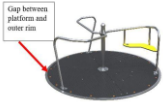
A weekly overview of the alerts on those products is published in English for free on <https://ec.europa.eu/safety-gate-alerts/screen/webReport#weeklyReports>. The measures taken in the notifying country in order to restrict such products’ marketing or use can be ordered by national authorities (“compulsory measures”) or be taken directly by producers and distributors (“voluntary measures”).

The official contact points of the Member and EFTA-EEA States provide the information published in these weekly overviews. Under the terms of Annex II.10 of the General Product Safety Directive (**2001/95/EC**) responsibility for the information provided lies with the notifying party. The Commission does not take any responsibility for the accuracy of the information provided.

Recall Summary – US Toys / Children’s Products

CPSC Recall List (Dec 2024)

Recall No.	Notifying Country	Product	Product Photo	Hazard / Risk	Remedy
25-067	USA	<p>Wireless Decorative Tree Light Controllers</p> <p>(Country of Origin: China)</p>		<p>Fire Hazard</p> <p>Mr. Christmas Recalls Wireless Decorative Tree Light Controllers Due to Fire Hazard</p> <p>The wireless receiver that plugs into an outlet can overheat, posing a fire hazard.</p>	<p>Consumers should immediately stop using this product and return it to their place of purchase to receive a full refund.</p>
25-069	USA	<p>Elongdi Magnetic Building Sticks Sets</p> <p>(Country of Origin: China)</p>		<p>Ingestion Hazard</p> <p>Magnetic Building Sticks Sets Recalled Due to Ingestion Hazard; Violation of Federal Regulations for Toy Magnets; Sold Exclusively on Amazon.com by Elongdi</p> <p>The recalled magnetic building sticks sets violates the mandatory federal regulation for magnet toys posing an ingestion hazard. When high-powered magnets are swallowed, the ingested magnets can attract each other, or another metal object, and become lodged in the digestive system. This can result in perforations, twisting and/or blockage of the intestines, infection, blood poisoning and death.</p>	<p>Consumers should stop using the recalled magnetic building sticks sets immediately, take them away from children, and contact Elongdi to receive a pre-paid label to return the recalled magnetic building sticks for a full refund. Amazon is notifying all known purchasers directly.</p>

25-070	USA	<p>Silicone Spoons for Babies</p> <p>(Country of Origin: China)</p>		<p>Choking Hazard</p> <p>Melii Baby Silicone Spoons for Babies Recalled Due to Choking Hazard; Imported by Melii Baby</p> <p>The silicone spoon can break apart while in use, posing a choking hazard to babies.</p>	<p>Consumers should immediately stop using the recalled spoons, keep them away from children and contact Melii Baby Inc. to receive a free replacement set. Consumers should take photographs of the spoons, discard the spoons in household waste, and then email the photographs to care@meliibaby.com to receive the free replacement set.</p>
25-079	USA	<p>Inclusive Orbit Merry-Go-Rounds</p> <p>(Country of Origin: United Kingdom)</p>		<p>Crushing Hazard</p> <p>The space between the rotating platform and the stationary outer rim can leave a gap that narrows too much, posing a crushing hazard to children.</p> <p>This recall involves the Inclusive Orbit, a spinning play component, similar to a merry-go-round, for playgrounds. The product has three handrails and a seat, and is designed for a capacity of six children. The platform surface is flush with the ground surrounding it. Recalled model numbers include 560-0042 or 560-0051. Owners of the equipment can contact BCI Burke to determine which unit they have.</p>	<p>Consumers should immediately stop using the recalled merry-go-rounds and contact the owner of the equipment, such as the park director or school principal, to determine if the equipment has been inspected and repaired. Contact BCI Burke to schedule an inspection and free onsite repair.</p>

* Source: www.recalls.gov


CPSC



The United States Consumer Product Safety Commission (CPSC) is an independent agency of the United States Government. To provide better service in alerting the American people to unsafe, hazardous or defective products, a “one stop shop” for U.S. Government recalls, <http://www.recalls.gov>, has been created. Members of the public may report unsafe products to CPSC by using the platform.



The recall list is divided into seven categories: Consumer Products, Motor Vehicles, Boats, Food, Medicine, Cosmetics and Environmental Products. Generally, the recall is conducted voluntarily by the company under CPSC’s Fast Track Recall program. Fast Track recalls are initiated by firms who are committed to working with CPSC to quickly announce the recall and remedy to protect consumers.



Recall Summary – Australia Toys / Children’s Products



ACCC Recall List (Dec 2024)


PRA No.	Notifying Country	Product / Description	Product Photo	Hazard / Risk	Remedy
2024/20367	Australia	<p>Car seat mat for young children.</p> <p>Available in blue and red.</p>		<p>Risk of Serious Injury or Death</p> <p>The product does not comply with the mandatory safety standard for child restraints for use in motor vehicles.</p> <p>Risk of serious injury or death to young children if the vehicle stops abruptly or is in an accident.</p>	<p>Stop using this product immediately.</p> <p>Contact Little Infants AU at support@littleinfants.com.au to arrange to return the product for a full refund, store credit or exchange for another product of equal value.</p> <p>Contact</p> <p>Little Infants AU Call: 0416 037 693 Trading hours: 8:00 AM to 5:00 PM (AWST)</p> <p>Email: support@littleinfants.com.au</p>

2024/20371	Australia	<p>Multicoloured soft play ball with rattles on two sides.</p> <p>Brand: Anko</p> <p>APN: 9341110379350</p>		<p>Risk of Serious Injury or Death</p> <p>The affected products may not comply with the mandatory standard for toys for children up to and including 36 months of age.</p> <p>The plastic dome containing the small balls can separate from the product creating small parts.</p> <p>There is a risk of serious injury or death from choking if young children put the small balls in their mouth.</p>	<p>Stop using the product immediately and keep it out of reach of children.</p> <p>Return the product to your place of purchase for a refund.</p> <p>Contact</p> <p>Kmart Australia Ltd Call: 1800 124 125 7:00 am to 6:00 pm, Monday to Friday.</p> <p>Visit the website https://www.kmart.com.au/contact-us/</p>
2024/20372	Australia	<p>Plush figures with pull string to activate talking features.</p> <p>Three characters available:</p> <p>Homer Simpson Bart Simpson Deadpool</p> <p>Contains 3 LR41 or LR44 button batteries.</p>		<p>Missing Warnings</p> <p>The product does not comply with the mandatory information standard for products containing button/coin batteries as it is missing the required warning information on the front panel.</p> <p>There is a risk of choking or serious injury if young children gain access to the button/coin batteries and swallow or place them inside their body.</p> <p>Consumers may not be aware that the product contains a button battery.</p>	<p>Keep the product out of reach of children.</p> <p>Contact Headstart or your place of purchase to receive a copy of the required warning information.</p> <p>Contact</p> <p>Headstart International Pty Ltd Call: 03 8763 3429 9:00 am to 3:00 pm, Monday to Friday</p> <p>Email: customerservice@headstartint.com</p>

2024/20382	Australia	<p>Magnetic puzzle game, includes small magnets and an interchangeable game board.</p>		<p>Risk of Serious Internal Injuries or Death</p> <p>This product does not comply with the permanent ban on small high-powered magnets.</p> <p>Risk of serious internal injuries or death if a child swallows more than one high-powered magnet as they stick together in the child's intestine or other digestive tissue. Risk of serious injury or death from choking.</p>	<p>Stop using these products immediately and keep them out of reach of children.</p> <p>Contact Booktopia customer support for a full refund and further instructions.</p> <p>Contact:</p> <p>Call: 1300 187 187</p> <p>Email: customersupport@booktopia.com.au</p>
2024/20383	Australia	<p>Fidget sensory tubes with LED lights in six colours:</p> <p>Pink Yellow Blue Green Red Purple</p>		<p>Risk of Choking</p> <p>The product does not comply with the mandatory standard for products containing button/coin batteries.</p> <p>The button/coin batteries are not adequately secured and are accessible to young children.</p> <p>Risk of choking, severe internal burn injuries or death to young children if they gain access to the button/coin batteries and swallow them or place them inside their body. Severe or fatal injuries can happen in 2 hours or less.</p>	<p>Consumers should stop using the glow sticks immediately and place them out of reach of children.</p> <p>Consumers should return the product to the Journey Church to receive a full refund.</p> <p>Contact</p> <p>Journey Church Call: 07 3281 0399</p> <p>Email: hello@journeychurch.com</p>

2024/20384	Australia	<p>Pickup tool with magnetic end.</p>		<p>Risk of Choking or Serious Injury</p> <p>The product does not comply with the mandatory standard for products containing button/coin batteries.</p> <p>The button/coin batteries are not adequately secured and are accessible to young children.</p> <p>There is a risk of choking or serious injury if young children gain access to the button/coin batteries and swallow or place them inside their body.</p>	<p>Consumers should stop using the pickup tool and store it out of reach of children.</p> <p>Consumers should return the product to the place of purchase for a full refund.</p> <p>Contact</p> <p>Bapcor Retail Call: 03 8878 1111 (9:00am – 5:00pm Monday to Friday)</p> <p>Email: imports@retail.bapcor.com.au</p>
2024/20387	Australia	<p>Powder-coated iron and plastic pressure-mounted baby gate, in white and black.</p> <p>Model: W3312/B3312</p>		<p>Risk of Serious Injury</p> <p>A child's body can fit between the gate slat and side wall and can become trapped.</p> <p>Risk of serious injury if a child becomes trapped between the gate and the wall.</p>	<p>Consumers should stop using the gate immediately.</p> <p>Consumers should contact Vevor to arrange a full refund of the gate.</p> <p>Contact</p> <p>Email: recalling@vevor.com</p>

2024/20388	Australia	<p>Flying Fox attachment for children's outdoor monkey bars.</p>		<p>Risk of Serious Injury or Death</p> <p>The accessory joiner may fail when in use.</p> <p>Risk of serious injury or death from falling if the accessory joiner fails during use.</p>	<p>Stop using affected flying foxes immediately.</p> <p>Vuly Play Group will contact known consumers to arrange for the supply of a replacement part.</p> <p>For more information or if you have not been contacted by Vuly Play Group:</p> <p>Contact</p> <p>Vuly Play Group Call: 1300 667 514</p> <p>Email: sales@vulyplay.com</p>
2024/20398	Australia	<p>24pc Polished ferrite magnetic fidget stones.</p> <p>Irregular shaped polished ferrite magnets.</p> <p>Grey and Rainbow coloured coating</p> <p>Item no. #9200</p>		<p>Risk of Serious Internal Injuries or Death</p> <p>This product does not comply with the permanent ban on small high-powered magnets.</p> <p>Risk of serious internal injuries or death if a child swallows more than one high-powered magnet, as they stick together in the child's intestine or other digestive tissue. Risk of serious injury or death from choking.</p>	<p>Stop using these products immediately and keep them out of reach of children.</p> <p>Please prepare the product for return in a cardboard box or padded bag and contact Aussie Magnets staff for a pre-paid return label and more information on your full refund.</p> <p>Contact</p> <p>The Aussie Magnet Co. Pty Ltd Call: 02 8729 8587 or 1300 287 624 (1800 AUS MAG)</p> <p>Email: sales@aussiemagnets.com.au</p>

2024/20363	Australia	Electric long tail cargo bike.		<p>Risk of Serious Injury or Accident</p> <p>The affected kickstand mounting plate welds may be faulty on some bicycles and the kickstand may fail if it overloaded.</p> <p>Consumers may not be aware of the risks associated with the kickstand use or carrying a passenger on the rear section of the bicycle.</p> <p>Risk of serious injury or accident if a passenger on the rear seat section of the bicycle comes into contact with the bicycle's moving parts.</p> <p>Risk of injury and property damage if the kickstand fails while in use.</p>	<p>Stop using affected bicycles and contact 99 Bikes to arrange for a frame inspection of your bicycle.</p> <p>99 Bikes will repair and attach warning labels to affected bicycles. Some bikes may require replacement of the entire frame.</p> <p>Contact:</p> <p>99 Bikes Pty Ltd Call: 1800 990 523 (7:30 AM to 4:00 PM Monday – Friday)</p> <p>Email: help@99bikes.com.au</p>
------------	-----------	---------------------------------------	---	--	---

Australian Product Safety System

The Australian product safety system is set up to maximize the safety of goods through the cooperation of consumers, businesses and agencies. This policy sets out the principles adopted by the Australian Competition and Consumer Commission (ACCC) for prioritizing and addressing product safety risks.

Under the Australian Consumer Law, a responsible Minister can order a compulsory recall when there are hazards on the products. A voluntary recall could be conducted to remove the product from the marketplace when the suppliers become aware of unsafe or defective products.

The ACCC administers a national recalls system for recalls of specific and general consumer products, and publishes all product recalls on the website <https://www.productsafety.gov.au/recalls>.

Recall Summary – Japan’s Toys / Children’s Products

CPSC Recall List (Dec 2024)

Date	Notifying Country	Product	Product Photo	Hazard / Risk	Remedy
2024年12月 13日 13 December 2024	Japan	玩具 Toy		一部の部品の接着が弱く、それらが外れた場合に子供が誤飲するおそれがあるため。 The adhesive of some parts is weak, and if they detach, there is a risk of accidental ingestion by children.	回収・返金 Recall and refund.

Japan’s Product Recall System (経済産業省リコール情報)

The METI (経済産業省 Ministry of Economy, Trade and Industry) administers a national recalls system for recalls of specific and general consumer products according to the Consumer Product Safety Act, and publishes all product recalls on the website: https://www.meti.go.jp/product_safety/recall/index.html and posting at <https://x.com/kochijiko>.

STC (Hong Kong Standards and Testing Centre) is a not-for-profit, independent testing, inspection and certification organization. With a global network of ISO/IEC 17025 accredited testing laboratories and over 60 years of experience in consumer product testing, we can meet your conformity assessment needs with highly efficient and reliable service. Our testing scope and capabilities related to toys and children's products include but are not limited to:

EU Requirements

- EN 71
- Phthalates (EC) no. 1907/2006
- Nickel Release (EC) no. 1907/2006
- Total Cadmium (EEC) no. 91/338
- Lead in Jewellery product (EC) no. 836/2012
- Azo-dye (EC) no. 1907/2006
- Bisphenol-A (2014/81/EU)
- DMF (Dimethyl fumarate) (EU) no. 2011/135
- Flame retardants TCEP, TCPP, TDCP (2014/79/EU)
- Package Waste Directive (94/62/EC)

US & Canada Requirements

- ASTM F963
- CPSIA
- California Proposition 65
- 16 CFR 1501
- ASTM F2923 (Children's jewellery)
- ASTM F2999 (Adult's jewellery)
- US Toxic in Packaging Clearinghouse (TPCH)
- CCPSA - Toys Regulations (SOR/2011-17)

Japan Requirements

- Japan Toy Safety Standard (ST)
- Japan Food Sanitation Law (JFSL)

Australia Requirements

- AS/NZS 8124
- Consumer Protection Notice No. 6 of 2010 - DEHP

FOR MORE DETAILS, PLEASE CONTACT US:

Hong Kong: hktcd@stc.group
Changzhou: czstc@stc.group
U.S.A.: usenquiry@stc.group

Guangdong: gdtcd@stc.group
Vietnam: vnstc@stc.group
Germany: grstc@stc.group

Shanghai: shtcd@stc.group
Japan: jpo@stc.group

